

Martin[®] Idler Conversion Kit



Eliminate Sag, Spillage, and Material Entrapment Improve Belt Support with Martin® Slider Bars.

The Martin® Idler Conversion Kit improves a conveyor's belt support system, stabilizing the line, improving sealing, and preventing spillage. This simple kit links two more troughing idler frames, replacing the wing rollers with Martin® Slider Bars.

BENEFITS

- Stable Belt Line Improves Sealing
 No more sag, no more spillage. Edge sealing systems work more effectively on stable belt line.
- Prevents Entrapment Damage
 Without sag, there's no risk of material becoming wedged in pinch point to gouge belt.
- Economical Conveyor Upgrade
 Reuse existing idler frames and center rollers for a cost-conscious system improvement.
- Reduces Maintenance
 No adjustment necessary; no lubrication required.
- Low Friction Surface Improve belt support without increasing drive power requirements.
- Flexible Placement
 Custom-length bars improve belt support points where conveyor needs it most, including tight spaces.
- Simple to Install
 Replace wing rollers easily; kit conforms to
 wide range of idler manufacturers.

PROBLEMS

Belt sag between idlers allows spillage, creating maintenance problems, cleanup costs, and regulatory issues.

Entrapped material gouges belt cover, shortening belt life.

SOLUTION

Stable sag-free belt line allows improved sealing for reduced spillage and reduced maintenance problems.

No bearings to seize; no lubrication required.

NOTES

Martin® Slider Cradles are designed to work with CEMA B, C and D belts with a maximum notch in the frame of 1.06 in.

Double Bar Conversion Kits are recommended for applications where conveyor capacity is more than 450 tons (408 metric tons) per hour, or where the wing rolls are longer than 13 inches (330 mm), as typically seen on belts over 36 inches (900 mm) wide.

Wing Roll must be a minimum of 14 1/2 in. to hold two bars.

To add an additional bar to belt widths less than 8" order P/N 37613. P/N 37613 contains 1 clamp assembly. Need 2-37613 per bar.

When installing more than four feet (1.2 m) of Martin® Slider Cradles, it is necessary to check for adequate power in the conveyor drive to overcome the additional friction against the belt. Contact Martin Engineering for additional information.

Martin® Slider Cradles are not recommended for conveyors operating at speed over 700 fpm (3.5 m/sec) or conveyors less than 50 ft (15 m) in length.

To improve belt support on short conveyors or highspeed belts, contact Martin Engineering.

TECHNICAL DATA SHEET


CONVERSION KIT

Select by belt width

Each kit includes idler conversion brackets and clamps for one idler set.

Note: Conversion kit does not include slider bars. Slider bars must be ordered separately.

Belt Width in. (mm)		P/N	Conversion Clamp QTY
24	(610)	37135-K24	2
30	(762)	37135-K30	2
36	(914)	37135-K36	2
42	(1067)	37135-K42	2
48	(1219)	37135-K48	4
54	(1372)	37135-K54	4
60	(1524)	37135-K60	4
66	(1676)	37135-K66	4
72	(1829)	37135-K72	4
84	(2134)	37135-K84	4
96	(2438)	37135-K96	4

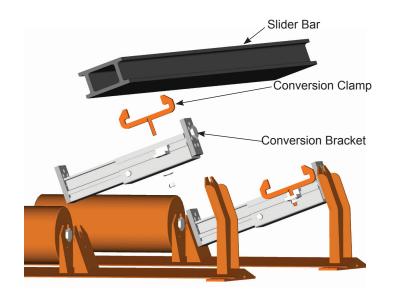

TO ORDER:

Measure distance supported and count the idlers to be converted.

Example				
30 in. (762 mm)				
32 ft. (9.75 m)				
8				

Correct Order		
Coversions Kit: P/N 37135-K30	Quantity: 8	
Slider Bars: P/N 37135-B96	Quantity: 8	

SLIDER BAR

Select by length of bar required

Bar Length ft. (mm)		Bar with Support Tube P/N	Replacement Bar without Support Tube P/N
3	(914)	37135-B36	37135-BE36
4	(1219)	37135-B48	37135-BE48
5	(1424)	37135-B60	37135-BE60
6	(1829)	37135-B72	37135-BE72
7	(2134)	37135-B84	37135-BE84
8	(2438)	37135-B96	37135-BE96
9	(2743)	37135-B108	37135-BE108
10	(3048)	37135-B120	37135-BE120
11	(3353)	37135-B132	37135-BE132
12	(3568)	37135-B144	37135-BE144

Each P/N is one bar; order enough bars for both sides of each cradle. Note if cradles need one bar or two bars per side.



Martin Engineering USA
One Martin Place
Neponset, IL 61345-9766 USA
800 544 2947 or 309 852 2384
Fax 800 814 1553
www.martin-eng.com

COMPANY WITH
QUALITY SYSTEM
CERTIFIED BY DNV GL
= ISO 9001 =